

### Magnetic Workholding



**Material Handling** 

Surface Grinding Chucks

**Magnetic Accessories** 

**Indicator** Arms

sPINner Deburring




2009

**Earth Chain Catalog** 

### **Table of Contents**



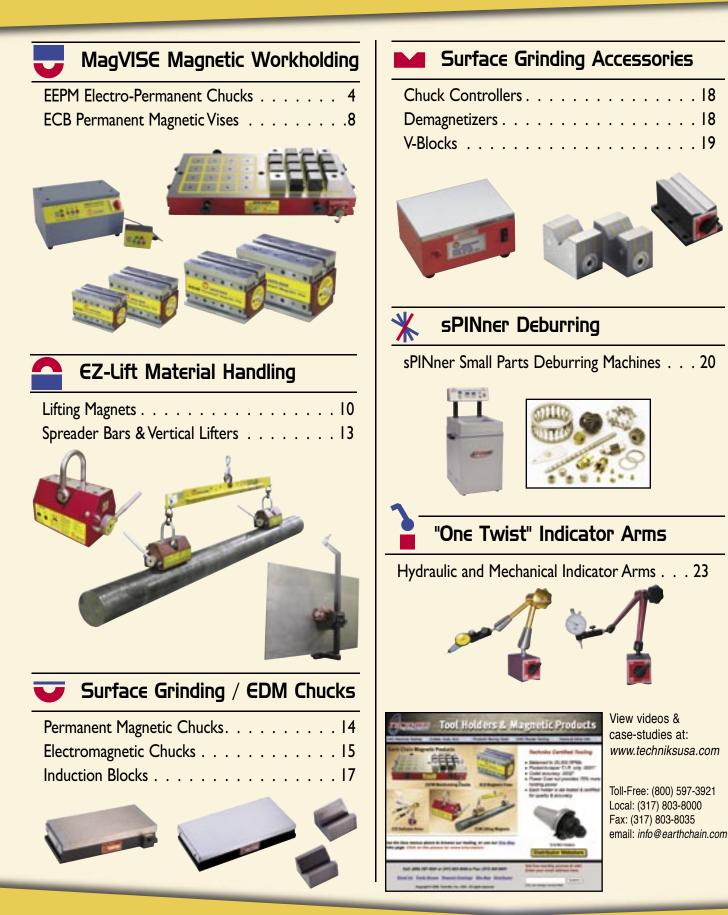

Call us toll free at (800) 597-3921 to place your order. www.techniksusa.com

### The Old Way: Vises And Chucks

#### A) Vise For Each Size Workpiece


Limited ability to hold different size workpieces.

- **B)** Part Distortion Clamping pressure causes part distortion and dead spots that cause chatter.
- **C)** Lost Productivity Takes longer to setup and can't machine on 5 sides



### The Old Way: Modular Fixturing

- A) Set It Up, Then Tear It Down Flexible, but labor intensive setups and tear-downs.
- **B)** Requires Training Complicated systems require skilled operators.
- **C)** Lost Productivity Long setup times and can't machine on 5 sides.

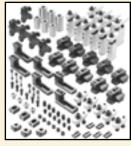

### The Earth Chain Way: EEPM Magnetic Chucks

#### A) 26 Sizes To Choose From

Each chuck can handle small or large, and thick or thin workpieces.

- **B) Magnetic Holding** Eliminates dead areas that cause chatter.
- **C)** Increase Productivity Fast setups & tear-downs. Machine 5-sides and thru-hole machining.



### The Earth Chain Way: ECB Magnetic Vises

#### A) Fast Setups

Position ECB Blocks as needed on your machine bed using toe-clamps.

- B) Anyone Can Use It Fast & simble to use. Layout to fit your workpiece.
- **C)** Increase Productivity Cut hours of setup-time. Machine 5-sides.



### The Old Way: Material Handling

#### A) Risk of Injury

Risk of injury to back, fingers, or toes when moving material in order to position sling or chain.

**B) Slings & Chains Wear Out** Lifting equipment needs to be recertified and replaced periodically.

**C)** Lost Productivity It takes time to properly setup slings or chains to safely move materials.

### Try It The Earth Chain Way

Thousands of customers use Earth Chain products to increase productivity, save money, and become more competitive. We offer state-of-theart magnetic workholding, material handling, and deburring solutions at very competitive prices. What makes us different, is we include full factory support before, during, and after the sale. Look to us when you need solutions that "load it & hold it" faster and safer.

EZ-Lift is the fastest and safest way to transport

Give us a try and see what we mean!

#### The Earth Chain Way: ELM Lifting Magnets

#### A) Safer – 3.5X Safety Factor

Simply center lifting magnet on workpiece to lift.

**B) EZ-Lift Lasts Forever** Rare-Earth magnet will never wear out and uses no electricity.

**C)** Increase Productivity

raw stock and workpieces.



#### Features:

- Machine 5 sides and through-hole drilling
- Will not lose holding power during power outage
- Spring-loaded induction blocks hold warped stock



Even holding eliminates "dead spots", reduces chatter, and minimizes part deformation.

Use magnetic workholding for drilling, milling, and boring operations on thick or thin<sup>\*</sup> workpieces. Magnetic power makes difficult workholding jobs faster and safer.

Our magnetic chucks easily integrate with pallet changing and tombstone systems used in production cells. Since no electricity is needed to keep the chuck ON, the electropermanent magnet keeps on holding tight even during a complete power loss.

\* Holding power varies with type of material and thickness.

#### **Benefits:**

- Cut set-up & part change-over times in half
- Improved machining for better finish and tool life
- Uniform holding = No workpiece deformation



Choose magnetic workholding for uniform holding of the workpiece, without part distortion or dead spots. Uniform workholding reduces chatter and harmonics for improved surface finish and tool life.



Magnetic chucks allow free access to machine on 5 sides

### The Old Way: Vises And Chucks


- A) Vise For Each Size Workpiece Limited ability to hold different size workpieces.
- B) Part Distortion Clamping pressure causes part distortion and dead spots that cause chatter.
- C) Lost Productivity Takes longer to setup and can't machine on 5 sides



#### The Earth Chain Way: EEPM Magnetic Chucks


#### A) 26 Sizes To Choose From

- Each chuck can handle small or large, and thick or thin workpieces.
- **B) Magnetic Holding** Eliminates dead areas that cause chatter.
- C) Increase Productivity Fast setups & tear-downs. Machine 5-sides and thru-hole machining.

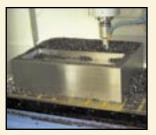

# MagVISE EEPM Application Examples 🥃

See a video of the EEPM chucks in action on our website: www.techniksusa.com

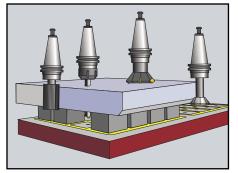

Machine 5 sides freely and thru-hole drill




Face milling warped stock



Works great for machining mold cavities



Flood coolant hole making application

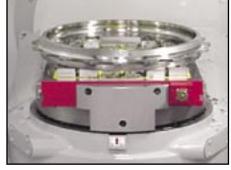

5 axis machining



Rotary Table application



Spring-blocks adjust to hold warped stock



Heavy side loads



Fast setups and part turnover



Works on thick or thin workpieces




Holding power to take big cuts




Use induction blocks as work stops


#### **Ordering Electro-Permanent Chucks:**

• Workpiece should cover at least 4 poles for maximum holding power.

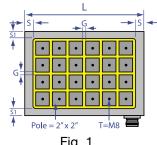

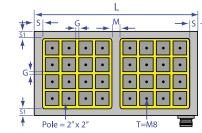

- Workpiece should be at least 0.4" thick
- Controller is included. Order subplates separately.

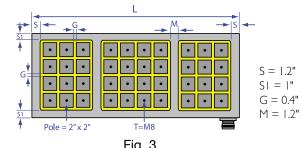

Controller EEPM-C1 EEPM-C1 EEPM-C2 EEPM-C2 EEPM-C2 EEPM-C1
EEPM-C1 EEPM-C2 EEPM-C2 EEPM-C2 EEPM-C1
EEPM-C1 EEPM-C2 EEPM-C2 EEPM-C1
EEPM-C2 EEPM-C2 EEPM-C1
EEPM-C2 EEPM-C1
EEPM-C1
EEPM-C1
EEPM-C1
EEPM-C2
EEPM-C4
EEPM-C4
EEPM-C2
EEPM-C4


\*Subplates are the same dimensions as the chucks, except they are 1" thick (H).

# MagVISE EEPM Chuck Accessories 🥃

#### **Pole Extensions**

#### **Use Pole Extensions For:**

- 5-sided machining and thru-hole drilling
- Holding warped or irregularly shaped stock
- · Create work-stops for accurate part alignment

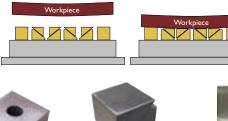



EEPM-S50









EEPM-SPF50-STOP


Controller is included with chuck. Order accessories separately.

Item #	Description	L x W x H
EEPM-S50	Fixed, soft induction block (8mm screw)	1.97" x 1.97" x 0.98"
EEPM-SP50	Spring adjusting induction block (2 pcs. set, 8mm screw)	1.92" x 1.81" x 1.81"
EEPM-SPF50	Fixed, soft induction block, use at corners with EEPM-SP50 spring blocks. (8mm screw)	1.97" x 1.97" x 1.65"
EEPM-SPF50-STOP	Fixed, soft induction block with work-stop (rotating) for fast, accurate positioning	1.97" x 1.97" x 1.65"
ECE-TC100	Toggle Clamps for holding non-ferrous materials (set of 2)	6.5" x 2" x 2.5"

#### **Machinable Subplates**

#### Order from page 6:

- Fast, repeatable part positioning
- Great for repeat jobs
- Protects chuck surface

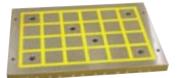


Subplates are sized to match your chuck. See page 6.



#### **Custom Tombstones**

#### Built to your specifications:

- Gang part setups together
- Fastest setups for pallet systems
- Ideal for work cube process

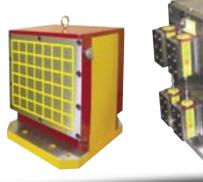



All our products are backed by our IOO% satisfaction guarantee.

# MagVISE ECB Permanent Magnetic Vises



#### **Features:**

- No electricity required
- Modular layout for custom setups
- Spring-loaded induction blocks hold warped stock

#### **Benefits:**

- Slash setup and part change over times
- 5-sided machining
- No workpiece deformation
- Improve machining performance

MagVISE Permanent Magnetic Vises slash setup times on horizontal or vertical CNC machine tools. They are used for all types of machining and boring operations on thin to thick workpieces.

No electricity is needed. Turn the magnetic vise "ON" and "OFF" with the turn of a wrench. Our magnetic vises easily integrate with pallet changing and tombstone systems for horizontal and vertical machining centers.




Magnetic workholding provides very even holding of the workpiece, without dead spots, so chatter is reduced while tool life and surface finish are improved. Rough or uneven stock is no problem to hold thanks to springloaded induction blocks that adjust to fit the workpiece.

See a short video of the MagVISE Magnetic Vises action on our website: www.techniksusa.com

Modular ECB magnetic vises hold irregular stock sizes, warped stock, and large workpieces, without the need for special fixturing.

#### The Old Way: Modular Fixturing

- A) Set It Up, Then Tear It Down Flexible, but labor intensive setups and tear-downs.
- **B) Requires Training** Complicated systems require skilled operators.
- C) Lost Productivity Long setup times and can't machine on 5 sides.

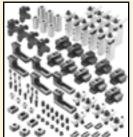

#### The Earth Chain Way: ECB Magnetic Vises

#### A) Fast Setups

Position ECB Blocks as needed on your machine bed using toe-clamps.

- B) Anyone Can Use It Fast & simple to use. Layout to fit your workpiece.
- C) Increase Productivity Cut hours of setup-time. Machine 5-sides.




# MagVISE ECB Application Examples 🥃





Irregular part setup

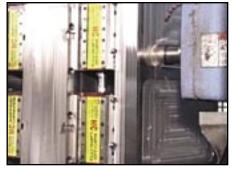

Horiziontal machining on a pallet system



Spring-blocks adjust to hold warped stock




Setup for a long and narrow part




Easily handle extra-large workpieces


#### **Ordering MagVISE Permanent Magnetic Vises**

Includes 2 machinable induction blocks, wrench, extension and socket, switch-connect socket assembly, 2 stop plates, 4 toe clamps.

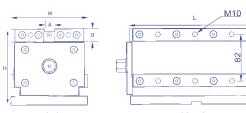

end view

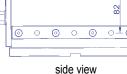

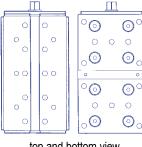

top and bottom view



#### **MagVISE ECB Vise Dimensions**

Model	L x W x H	Α	В	Min. Stock Thickness	Holding Power	Weight	
ECB-050	5" x 3" x 3"	.47"	.47"	0.4"	1,100 lbs.	15 lbs.	
ECB-075	6.8" x 3" x 3"	.47"	.47"	0.4"	1,650 lbs.	19 lbs.	
ECB-120	7.3" x 4.2" x 4.2"	.62"	.59"	0.6"	2,640 lbs.	40 lbs.	
ECB-210	9.2" x 5.2" x 5.3"	.65"	.84"	0.8"	4,620 lbs.	80 lbs.	
ECB-SPF50	1, soft fixed induction	olock, 10mm s	crew - use with	ECB-SP50 spring blocks. Dim	ensions: 1.97" x 1.97" :	x 1.65"	
ECB-SP50	2, spring loaded induction block, 10mm screw - use with ECB-SPF50 on corners. Dimensions: 1.89" x 1.81" x 1.89"						
ECE-TC100	ECE-TC100 Toggle Clamps for holding non-ferrous materials such as aluminum and brass. (set of 2)						

Note: Holding power depends on workpiece size, material, surface finish, contact area with magnet, and workpiece thickness.

### Smallest, Most Powerful Lifter – With The Best Safety Factor (3.5 X)

#### Features:

- · No electricity required
- Fastest & Safest way to lift
- Lift flat or round stock
- Capacity up to 6,600 lbs., higher with spreader bars

#### **Benefits:**

- Safer than straps and slings
- · Never needs to be re-certified
- So simple anyone can use it
- Reduces transport and setup time for more productivity

Our customers prefer ELM lifting magnets because they are the smallest, most powerful lifting magnet available with a **3.5X SAFETY FACTOR.** <u>Our safety</u> <u>factor is the best in the industry.</u>

ELM lifters feature super-powerful rareearth neodymium iron boron lifting magnets that require no electricity and have dozens of uses. Load and unload plate, block, or round steel and iron stock. Use them on press molds, machined parts, and other ferrous materials. Use spreader bars to lift large material.



### The Old Way: Material Handling

A) Risk of Injury

Risk of injury to back, fingers, or toes when moving material in order to position sling or chain.

B) Slings & Chains Wear Out Lifting equipment needs to be recertified and replaced periodically.

#### **C)** Lost Productivity

It takes time to properly setup slings or chains to safely move materials.

#### The Earth Chain Way: ELM Lifting Magnets

- A) Safer 3.5X Safety Factor Simply center lifting magnet
  - Simply center lifting magnet on workpiece to lift.
- B) EZ-Lift Lasts Forever Rare-Earth magnet will never wear out and uses no electricity.



C) Increase Productivity EZ-Lift is the fastest and safest way to transport raw stock and workpieces.

### EZ-Lift Application Examples



Safest way to move ferrous stock.



Use to setup CNC machining centers.



Center magnet on workpiece to lift.



Beveled bottom surface lifts tube steel easily.



Use spreader bars for large or unbalanced loads.



Vertical Lifters can be operated by one person.



Eliminate straps, slings and associated dangers.



Locate magnet at balance point for lifting.



#### **Best Safety Factor Available**

All our lifting magnets have a safety factor of 3.5 times the rated capacity.

#### **EZ-Lift Operation**

Calculate Maximum Load for your stock. Center the magnet on the workpiece. Move lever to the "ON" position to lift. Follow all directions in the Operating Instructions that comes with your magnet.






Lever in the ''ON'' position.The safety lock is engaged.

Lever in the ''OFF'' position.

#### How It Works:

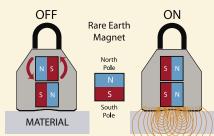


Each ELM lifting magnet contains super powerful rare earth magnets arranged in 3 rows. The OFF position is when the magnetic poles are in alignment as shown (top left).

Turning the lever to the ON position rotates the center row of magnets 180° so the poles alternate, creating a powerful magnetic field.

Never attempt to turn the magnet ON unless it is placed on a correctly sized piece of material to be moved, or you may cause injury to yourself, or the ELM lifting magnet. Always follow all instructions carefully.

Ordering	g Informa	ation a	and Ra	ated C	apac	ities ·	- Plat	:e & I	Roun	d Steel
Plate	Round	Α	В	C	D	E	F	G	H	Weight
220 lbs.	99 lbs.	4.2"	3.3"	4.7"	4.9"	2.4"	2.8"	1.6"	1.2"	5.5 lbs.
660 lbs.	300 lbs.	7.1"	6.1"	6.1"	7.3"	3.6"	3.7"	2.0"	1.6"	18.9 lbs.
1,320 lbs.	600 lbs.	10.0"	8.8"	8.3"	10.2"	4.5"	4.7"	3.0"	2.0"	46 lbs.
2,200 lbs.	990 lbs.	11.0"	9.6"	11.3"	14.6"	6.5"	6.7"	3.8"	3.4"	101 lbs.
4,400 lbs.	1,980 lbs.	16.6"	15.0"	13.7"	20.2"	8.5"	8.5"	4.1"	4.8"	259 lbs.
6,600 lbs.	2,970 lbs.	22.3"	20.9"	15.7"	30.3"	8.5"	8.7"	5.8"	3.2"	399 lbs.
	Plate           220 lbs.           660 lbs.           1,320 lbs.           2,200 lbs.           4,400 lbs.	Plate         Round           220 lbs.         99 lbs.           660 lbs.         300 lbs.           1,320 lbs.         600 lbs.           2,200 lbs.         990 lbs.           4,400 lbs.         1,980 lbs.	Plate         Round         A           220 lbs.         99 lbs.         4.2"           660 lbs.         300 lbs.         7.1"           1,320 lbs.         600 lbs.         10.0"           2,200 lbs.         990 lbs.         11.0"           4,400 lbs.         1,980 lbs.         16.6"	Plate         Round         A         B           220 lbs.         99 lbs.         4.2"         3.3"           660 lbs.         300 lbs.         7.1"         6.1"           1,320 lbs.         600 lbs.         10.0"         8.8"           2,200 lbs.         990 lbs.         11.0"         9.6"           4,400 lbs.         1,980 lbs.         16.6"         15.0"	Plate         Round         A         B         C           220 lbs.         99 lbs.         4.2"         3.3"         4.7"           660 lbs.         300 lbs.         7.1"         6.1"         6.1"           1,320 lbs.         600 lbs.         10.0"         8.8"         8.3"           2,200 lbs.         990 lbs.         11.0"         9.6"         11.3"           4,400 lbs.         1,980 lbs.         16.6"         15.0"         13.7"	Plate         Round         A         B         C         D           220 lbs.         99 lbs.         4.2"         3.3"         4.7"         4.9"           660 lbs.         300 lbs.         7.1"         6.1"         6.1"         7.3"           1,320 lbs.         600 lbs.         10.0"         8.8"         8.3"         10.2"           2,200 lbs.         990 lbs.         11.0"         9.6"         11.3"         14.6"           4,400 lbs.         1,980 lbs.         16.6"         15.0"         13.7"         20.2"	Plate         Round         A         B         C         D         E           220 lbs.         99 lbs.         4.2"         3.3"         4.7"         4.9"         2.4"           660 lbs.         300 lbs.         7.1"         6.1"         6.1"         7.3"         3.6"           1,320 lbs.         600 lbs.         10.0"         8.8"         8.3"         10.2"         4.5"           2,200 lbs.         990 lbs.         11.0"         9.6"         11.3"         14.6"         6.5"           4,400 lbs.         1,980 lbs.         16.6"         15.0"         13.7"         20.2"         8.5"	Plate         Round         A         B         C         D         E         F           220 lbs.         99 lbs.         4.2"         3.3"         4.7"         4.9"         2.4"         2.8"           660 lbs.         300 lbs.         7.1"         6.1"         6.1"         7.3"         3.6"         3.7"           1,320 lbs.         600 lbs.         10.0"         8.8"         8.3"         10.2"         4.5"         4.7"           2,200 lbs.         990 lbs.         11.0"         9.6"         11.3"         14.6"         6.5"         6.7"           4,400 lbs.         1,980 lbs.         16.6"         15.0"         13.7"         20.2"         8.5"         8.5"	Plate         Round         A         B         C         D         E         F         G           220 lbs.         99 lbs.         4.2"         3.3"         4.7"         4.9"         2.4"         2.8"         1.6"           660 lbs.         300 lbs.         7.1"         6.1"         6.1"         7.3"         3.6"         3.7"         2.0"           1,320 lbs.         600 lbs.         10.0"         8.8"         8.3"         10.2"         4.5"         4.7"         3.0"           2,200 lbs.         990 lbs.         11.0"         9.6"         11.3"         14.6"         6.5"         6.7"         3.8"           4,400 lbs.         1,980 lbs.         16.6"         15.0"         13.7"         20.2"         8.5"         8.5"         4.1"	220 lbs.       99 lbs.       4.2"       3.3"       4.7"       4.9"       2.4"       2.8"       1.6"       1.2"         660 lbs.       300 lbs.       7.1"       6.1"       6.1"       7.3"       3.6"       3.7"       2.0"       1.6"         1,320 lbs.       600 lbs.       10.0"       8.8"       8.3"       10.2"       4.5"       4.7"       3.0"       2.0"         2,200 lbs.       990 lbs.       11.0"       9.6"       11.3"       14.6"       6.5"       6.7"       3.8"       3.4"         4,400 lbs.       1,980 lbs.       16.6"       15.0"       13.7"       20.2"       8.5"       8.5"       4.1"       4.8"

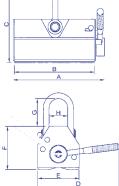

#### Formula for Calculating Maximum Load by Material Type

**T** (thickness)  $\times$  **F** (finish)  $\times$  **M** (material)  $\times$  Capacity = ML Example: (ELM-600/plate steel) 2" (T=100%) x F2(100%) x M2 (85%) x 1,320 lbs. = 1,122 lbs.

#### M Lifting Power by Material

		0%			10	0%
Content	M1	Low Carbo	'n			100%
	M2	Moderate	Carbon		85	5%
Carbon	M3	High Carbo	on	75	%	
S	M4	Cast Iron		70%		

**Surface Finish** 

#### **Rated Capacity**

#### **F** Effect of Surface Finish

	0% 50%	1(	00%	150%
F1	abla  abla  abla Ground S	125%		
F2	abla  abla Rough Mach	nined	100%	
F3	abla Foundry Finis	h	90%	
F4	∼ Rough Cast	65%		

#### **Calculating Maximum Loads**

Calculate that the magnet will safely lift your material. Maximum Load (ML) is different for plate and round materials, and also depends upon stock thickness, carbon content, and surface finish. Use the formula and tables to calculate ML for your material type.

#### **T** Equals Percent of Lifting Power by T (thickness)


Model	Plate Steel*	т	ELM-100	ELM-300	ELM-600	ELM-1000	ELM-2000	ELM-3000	
ELM-100	220 lbs.	2 3/8" (60mm)	100%	100%	100%	100%	100%	100%	
ELM-300	660 lbs.	2 1/8" (55mm)	100%	100%	100%	100%	100%	95%	
ELM-600	1,320 lbs.	2.0" (50mm)	100%	100%	100%	100%	95%	90%	
ELM-1000	2,200 lbs.	1 3/4" (45mm)	100%	100%	100%	100%	90%	85%	
ELM-2000	4,400 lbs.	1 1/2" (40mm)	100%	100%	100%	100%	85%	80%	
ELM-3000	6,600 lbs.	1 3/8" (35mm)	100%	100%	100%	90%	75%	70%	
Model	Round Steel*	1 1/8" (30mm)	100%	100%	100%	80%	65%	60%	
ELM-100	99 lbs.	1.0" (25mm)	100%	100%	90%	70%	55%	50%	
ELM-300	300 lbs.	3/4" (20mm)	100%	90%	75%	60%	45%	40%	
ELM-600	600 lbs.	1/2" (15mm)	100%	70%	60%	50%	35%	30%	
ELM-1000	990 lbs.	3/8" (10mm)	70%	50%	45%	35%	25%	20%	
ELM-2000	1,980 lbs.	1/4" (5mm)	40%	30%	25%	20%	15%	10%	
ELM-3000	2,970 lbs.	s. *Follow all directions in the Operating Instructions that comes with your magnet.							

## **EZ-Lift Material Handling Accessories**


#### **EZ-Lift Spreader Bars**

- For better overall balance
- · Use with multiple lifters
- Lifter span adjustable

Keeps large materials balanced for safer transport.

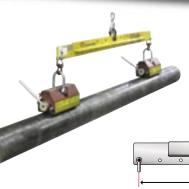

Control large or irregular loads during transport. Increase lifting power by adding more magnets. Includes bar, 1 upper and 2 lower S.P.A. shackles. Order magnets separately.

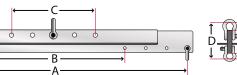

Model	Capacity	Α	В	С	D	E	F	Weight
ELM-SB250	250 lbs.	36"	18"	12"	5.1"	1.25"	.85"	20 lbs.
ELM-SB500	500 lbs.	46"	22"	16"	5.7"	1.35"	1.34"	25 lbs.
ELM-SB1000	1,000 lbs.	72"	36"	24"	6.9"	1.35"	1.34"	65 lbs.
ELM-SB2000	2,000 lbs.	72"	36"	24"	7.3"	2.02"	1.35"	115 lbs.
ELM-SB4000	4,000 lbs.	77"	41"	24"	10.5"	2.43"	1.63"	195 lbs.
ELM-SB8000	8,000 lbs.	96"	48"	24"	12.3"	2.94"	1.78"	300 lbs.
ELM-SB10000	10,000 lbs.	116"	56"	24"	14.7"	3.5"	1.65"	600 lbs.
ELM-SB13500	13,500 lbs.	140"	68"	36"	17.1"	4.0"	2.02"	880 lbs.

#### **EZ-Lift Vertical Lifters**

- Fast loading for vertical transport
- One person can load and unload
- No dangerous straps & slings



Used for vertical transport of plate stock. Includes ELM lifting magnet.

material. Sold in pairs.

				Plate Size L x W x H (min/max)				
Model	Size L x W x H	Capacity	Weight	L	W	н		
ELM-300V	37.5" x 8.5" x 10"	660 lbs.	57 lbs.	8"/60"	11.8"/31.5"	0.25"/5.9"		
ELM-600V	46" x 11" x 10"	1,320 lbs.	86 lbs.	12"/72"	11.8"/39.4"	0.31"/9.8"		
ELM-1000V	48" x 14" x 12"	2,200 lbs.	128 lbs.	12.5"/79"	11.8"/39.4"	0.39"/11.8"		




Position lifter on stock and turn the lever to the on position. Hoist into vertical position for transport. Always follow operating instructions included.


#### **EZ-Lift Magnetic Separators**

- Separates sheet stock for easy transport
- Great for press-brakes or sheet feeders
- Makes separating oily or stuck sheets easy

Model	В	Н	L	I	d	b	Maximum Thickness
EF-10	133	87	61	51	8	56	2.0mm
EF-20	136	127.5	61	51	8	80	3.2mm
EF-40	215	251	75	60	11	150	3.2mm

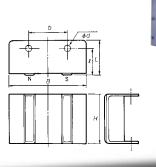

Separates iron or steel sheets for easy feeding into automatic sheet feeding equipment or for manual transport. Will separate irregularly shaped

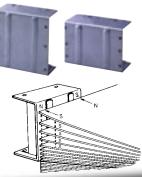

#### EDMT and EDTW Permanent Magnetic Chucks:

- EDM-READY: fully submersible, brass welded faceplate
- Powerful Rare Earth Neodymium Iron Boron magnets are 5 times stronger than other magnets
- Low-profile design increases Z-axis stroke
- Demagnetizers on page 18

#### EDMT (All-Purpose Variable Pole Design)

Alternating thick/thin magnetic poles provides best holding power for both thick and thin workpieces.

Model	Pole Pitch (P)	L x W x H	Weight
EDMT-1018	11.2 (1.6+2+1.6+6)	7" x 4" x 2.5"	16 lbs
EDMT-1325	11.2 (1.6+2+1.6+6)	10" x 5" x 2.5"	23 lbs
EDMT-1530	11.2 (1.6+2+1.6+6)	12" x 6" x 2.5"	33 lbs
EDMT-1535	11.2 (1.6+2+1.6+6)	14" x 6" x 2.5"	38 lbs
EDMT-1545	11.2 (1.6+2+1.6+6)	18" x 6" x 2.5"	44 lbs
EDMT-2040	11.2 (1.6+2+1.6+6)	16" x 8" x 2.5"	57 lbs
EDMT-2045	11.2 (1.6+2+1.6+6)	18" x 8" x 2.5"	66 lbs
EDMT-2050	11.2 (1.6+2+1.6+6)	20" x 8" x 2.5"	79 lbs
EDMT-2550	4 + 12	20" x 10" x 2.5"	130 lbs
EDMT-3060	3 + 15	24" x 12" x 2.5"	198 lbs

#### **EDTW** Fine Pole:


Fine pole design provides best holding power on workpieces over 2mm thick.




Model	Pole Pitch (P)	L x W x H	Weight
EDTW-1018	2 (1+1)	7" x 4" x 2"	15 lbs.
EDTW-1325	2 (1+1)	10" x 5" x 2.25"	29 lbs.
EDTW-1515	2 (1+1)	6" x 6" x 2.25"	20 lbs.
EDTW-1530	2 (1+1)	12" x 6" x 2.5"	49 lbs.
EDTW-1535	2 (1+1)	14" x 6" x 2.5"	53 lbs.
EDTW-1545	2 (1+1)	18" x 6" x 2.5"	68 lbs.
EDTW-2040	2 (1+1)	16" x 8" x 2.5"	82 lbs.
EDTW-2045	2 (1+1)	18" x 8" x 2.5"	90 lbs.
EDTW-2050	2 (1+1)	20" x 8" x 2.5"	99 lbs.
EDTW-2550	2 (1+1)	20" x 10" x 2.5"	132 lbs.



Variable pole design EDMT chucks.

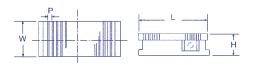


#### Variable Pole

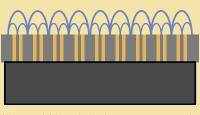


\*New variable pole design creates magnetic fields that hold both thin and thick workpieces equally well.

#### **Fine Pole**

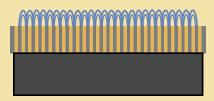

Fine pole array creates strongest magnetic field close to surface for holding thin workpieces.



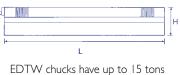


of holding force. (150 lbs./inch<sup>2</sup>)

# Surface Grinding – Electromagnetic Chucks 🐱

#### **EET Electromagnetic Chucks:**

- EDM-READY: fully submersible, brass sealed
- Hard soldered top plate and solid bottom plate for maximum rigidity and accuracy
- Strong magnetic force regulated by controller

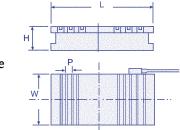



See page 18 for chuck controllers

Model	Pole Pitch (P)	L x W x H	Volts	Amps	Weight
EET-1530	15 (3+12)	12" x 6" x 3"	DC90V	0.18	44 lbs.
EET-1535	15 (3+12)	14" x 6" x 3"	DC90V	0.19	53 lbs.
EET-1545	15 (3+12)	18" x 6" x 3"	DC90V	0.19	66 lbs.
EET-2040	15 (3+12)	16" x 8" x 3"	DC90V	0.28	84 lbs.
EET-2045	15 (3+12)	18" x 8" x 3"	DC90V	0.28	90 lbs.
EET-2050	15 (3+12)	20" x 8" x 3"	DC90V	0.36	99 lbs.
EET-2550	15 (3+12)	20" x 10" x 3"	DC90V	0.46	143 lbs.
EET-3060	15 (3+12)	24" x 12" x 3"	DC90V	0.86	179 lbs.
EET-3070	15 (3+12)	28" x 12" x 3"	DC90V	0.81	205 lbs.
EET-3090	15 (3+12)	35" x 12" x 3"	DC90V	1.05	276 lbs.
EET-4060	19 (3+16)	24" x 16" x 3.5"	DC90V	0.95	287 lbs.
EET-4070	19 (3+16)	28" x 16" x 3.5"	DC90V	1.21	333 lbs.
EET-4080	19 (3+16)	32" x 16" x 3.5"	DC90V	1.31	384 lbs.
EET-40100	19 (3+16)	40" x 16" x 3.5"	DC90V	1.33	487 lbs.
EET-50100	19 (3+16)	40" x 20" x 3.5"	DC90V	1.46	595 lbs.
EET-50150	19 (3+16)	60" x 20" x 3.5"	DC90V	3.37	893 lbs.
EET-60100	19 (3+16)	40" x 24" x 3.5"	DC90V	2.80	728 lbs.
EET-60150	19 (3+16)	60" x 24" x 3.5"	DC90V	2.85	1091 lbs.
EET-80100	19 (3+16)	40" x 32" x 3.5"	DC90V	3.80	970 lbs.

#### **EET-W** Fine Pole Electromagnetic Chuck:

• Fine pole design provides best holding power on workpieces over 2mm thick




L	-+I I P	0000000
	W	
	L	

Model	Pole Pitch (P)	L x W x H	Volts	Amps	Weight
EET-1530W	4(1+3)	12" x 6" x 4.5"	DC90V	0.73	73 lbs.
EET-1535W	4(1+3)	14" x 6" x 4.5"	DC90V	0.61	88 lbs.
EET-1545W	4(1+3)	18" x 6" x 4.5"	DC90V	0.98	110 lbs.
EET-2040W	4(1+3)	16" x 8" x 4.5"	DC90V	1.10	139 lbs.
EET-2045W	4(1+3)	18" x 8" x 4.5"	DC90V	1.20	157 lbs.
EET-2050W	4(1+3)	20" x 8" x 4.5"	DC90V	1.40	176 lbs.
EET-2550W	4(1+3)	20" x 10" x 4.5"	DC90V	1.00	247 lbs.
EET-3060W	4(1+3)	24" x 12" x 4.5"	DC90V	1.50	331 lbs.

# Surface Grinding – Electromagnetic Chucks


#### **EET-WL** Fine Pole - Lengthwise

• Brass welding protects faceplate from coolant corrosion

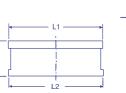

L1

L2

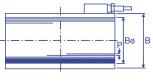




			Face Plate			Current	
Model	L x W x H	В	L1	Ве	Pole Pitch (P)	Amp/DCV	Weight
EET-1530WL	12" x 6" x 4"	150mm	300mm	125mm	4(1+3)	.39/90	42 lbs.
EET-1535WL	14" x 6" x 4"	150mm	350mm	125mm	4(1+3)	.52/90	51 lbs.
EET-1545WL	18" x 6" x 4"	150mm	450mm	125mm	4(1+3)	.60/90	64 lbs.
EET-2040WL	16" x 8" x 4"	200mm	400mm	173mm	4(1+3)	.69/90	75 lbs.
EET-2045WL	18" x 8" x 4"	200mm	450mm	173mm	4(1+3)	.90/90	84 lbs.
EET-2050WL	20" x 8" x 4"	200mm	500mm	173mm	4(1+3)	1.01/90	93 lbs.
EET-2060WL	24" x 8" x 4"	200mm	600mm	173mm	4(1+3)	1.31/90	112 lbs.
EET-2540WL	16" x 10" x 4"	250mm	400mm	225mm	4(1+3)	1.00/90	112 lbs.
EET-2545WL	18" x 10" x 4"	250mm	450mm	225mm	4(1+3)	1.10/90	123 lbs.
EET-2550WL	20" x 10" x 4"	250mm	500mm	225mm	4(1+3)	1.33/90	137 lbs.
EET-3060WL	24" x 12" x 4"	300mm	600mm	273mm	4(1+3)	1.52/90	216 lbs.

#### **EET-Z Super Power Pole**

- Specially designed for heavy cutting.
- For work pieces 0.5" or thicker

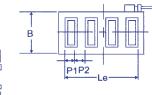




			Face Plate		Pole P	itch (P)	Current	
Model	L x W x H	В	L1	Le	P1	P2	Amp/DCV	Weight
EET-2050Z	20" x 8" x 5"	200mm	500mm	442mm	34	33	1.40/90	170 lbs.
EET-2060Z	24" x 8" x 5"	200mm	600mm	546mm	36	36	1.70/90	207 lbs.
EET-2080Z	32" x 8" x 5"	200mm	800mm	741mm	35	35	2.30/90	275 lbs.
EET-2550Z	20" x 10" x 5"	250mm	500mm	442mm	34	33	1.80/90	216 lbs.
EET-2560Z	24" x 10" x 5"	250mm	600mm	546mm	36	36	2.10/90	258 lbs.
EET-3060Z	24" x 12" x 5"	300mm	600mm	546mm	36	36	2.60/90	308 lbs.
EET-3090Z	35" x 12" x 5"	300mm	900mm	840mm	35	35	4.00/90	462 lbs.
EET-4080Z	32" x 16" x 5"	400mm	800mm	741mm	35	35	4.70/90	551 lbs.
EET-40100Z	40" x 16" x 5"	400mm	1000mm	938mm	35	34	5.80/90	695 lbs.
EET-50100Z	40" x 20" x 5"	500mm	1000mm	938mm	35	34	7.20/90	882 lbs.
EET-50150Z	60" x 20" x 5"	500mm	1500mm	1430mm	37	36	9.00/90	1,323 lbs.
EET-60100Z	40" x 24" x 5"	600mm	1000mm	938mm	35	34	8.00/90	1,058 lbs.
EET-60150Z	60" x 24" x 5"	600mm	1500mm	1430mm	37	36	10.1/90	1,620 lbs.

#### **EHT Induction Blocks:**

- Extends magnetic force to hold bar, round, or irregular shapes
- EDM-READY: fully submersible, brass sealed
- For fine-pole and standard pole applications
- Choose from lengthwise (L) or width-wise (W) pole direction
- For permanent and/or electromagnetic chucks

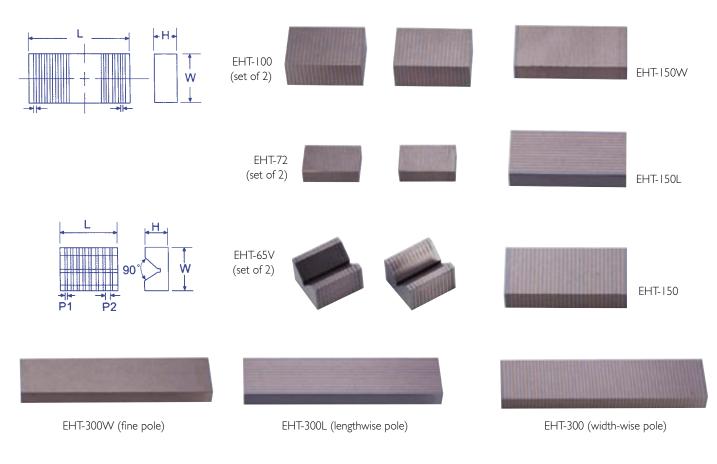

Model	Qty.	L x W x H	Pole Pitch P1	Pole Pitch P2	Weight
EHT-65V	2	2.5" x 2.5" x 1.5"	2	3	4 lbs. (x2)
EHT-72	2	3" x 2" x 1"	2	3	7 lbs. (x2)
EHT-100	2	4" x 3" x 1.5"	2	3	10 lbs. (x2)
EHT-150	1	6" x 3" x 1"	2	3	5 lbs.
EHT-300	1	12" x 3" x 1"	2	3	10 lbs.
EHT-150L	1	6" x 3" x 1"	2	3	5 lbs.
EHT-300L	1	12" x 3" x 1"	2	3	10 lbs.
EHT-150W	1	6" x 3" x 1"	1+1	1+1	5 lbs.
EHT-300W	1	12" x 3" x 1"	1+1	1+1	10 lbs.

# Grinding Chuck Controllers – Demagnetizers

#### ERD-505, 510, 515 Features:

- Work with any electromagnetic chucks
- Demagnetizing time is 6-15 seconds
- Precisely regulates the magnetic force

#### **ERD-520** Features:

- · For larger, more powerful electromagnetic chucks
- Can operate two chucks at the same time
- Demagnetizing time is 8-15 seconds





ERD-505

ERD-510, ERD-515



ERD-520

Model	Input Voltage/Single Phase	Output Volts	Output Amps	Dim. L x W x H	Weight
ERD-505	AC 110/220V	DC 0-100V	5A	8" x 5.5" x 5"	8 lbs.
ERD-510	AC110/220/440V	DC 0-120V	10A	6" x 13" x 10"	33 lbs.
ERD-515	AC 220/440V	DC 0-120V	15A	6" x 13" x 10"	44 lbs.
ERD-520	AC 220/440V	DC 0-120V	20A	7" x 15" x 12"	71 lbs.

Please specify voltage when ordering.

#### **EDH** Demagnetizers



Model	Description	Power	Capacity	Duty Cycle	Dim. L x W x H	Weight
EDH-123	Portable, light weight, use on big machines	AC 110V	110VA	90%	123 x 83 x 83mm	4 lbs.
EDB-180	For up to 20 minutes continuous operation	AC 110/220V	220VA	50%	127 x 180 x 90mm	9 lbs.
EDS-200	For continuous operation, double-coil design	AC 110V	330VA	100%	150 x 200 x 100mm	19 lbs.


### **Magnetic Square and V-Blocks**




#### **ECE Magnetic Blocks**

- Dozens of uses around the shop
- Fast setups of bar stock or round steel
- Powerful magnetic base, ON-OFF switch



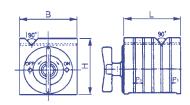


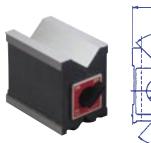


ECE-208 / ECE-212



ECE-612

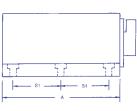

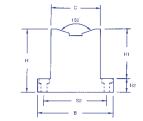

	Holding	Power			[	Dimensio	ons mm				
Model	V-Face	Surface	В	L	Н	С	H1	H2	S1	S2	Weight
ECE-100	61 lbs.	88 lbs.	100	100	100	-	-	-	-	-	14.5 lbs.
ECE-150	110 lbs.	308 lbs.	150	150	150	-	-	-	-	-	53 lbs.
ECE-208	121 lbs.	154 lbs.	56	80	72	-	-	-	-	-	6.5 lbs.
ECE-212	198 lbs.	242 lbs.	75	115	100	-	-	-	-	-	11 lbs.
ECE-612	242 lbs.	350 lbs.	76	118	62	50	50	12	48	62	5.5 lbs.

#### **ECE Magnetic V-Block Sets**

- For grinding, marking, measuring and other light machining operations
- Each pair made to identical dimensions
- Sold in pairs only




ECE-507



ECE-510

	Holding	Applicable	Din	nension n	ım	
Model	Power	Diameter mm	В	L	н	Weight
ECE-507	33 lbs.	50	40	72	50	2.2 lbs. x 2
ECE-510	44 lbs.	80	50	100	80	6.6 lbs. x 2

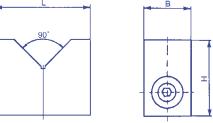

### Tough & reliable, the sPINner is KING of small precision parts deburring!



#### The Old Way: Deburring Parts

- A) Time Consuming Hand deburring is labor intensive and time consuming process
- **B) Production Bottleneck** Deburring often limits how productive you can be
- C) Expensive Deburring requires expensive manual labor driving costs up



### The Earth Chain Way: sPINner Deburring

- A) Deburr Faster & Better Improve part quality and get more consistent results
- **B) Speeds Production** Batch deburr dozens, hundreds, or thousands of parts in minutes
- C) Reduce Costs Eliminate expensive hand deburring and increase production





### Send us your parts for a free deburring analysis!

The sPINner works best on small, precision parts, made from non-ferrous metals including: aluminum, brass, copper, stainless steel, and titanium. The deburring process will not affect tolerances or damage delicate parts.


Send your parts to: Earth Chain / Deburring 9930 East 56th St., Indianapolis, IN 46236



**Typical Deburred Parts** 



The sPINner deburrs these part features

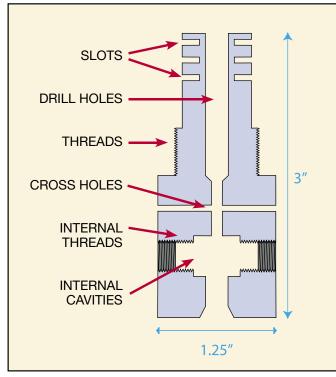

#### Medical Application




The sPINner is used in many industries including medical, aerospace, and electronics. It is also a good fit for most parts made on CNC Swiss-type lathes.

#### **Aluminum Gear Application**

Burrs and rough edges. Deburred part in only 10 minutes. Part Dimensions: 1 9/16" diameter x 5/16" high.



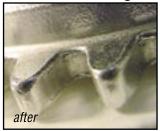


#### **Complex Turned & Machined Aluminum** Burrs on O.D. and in I.D. slots. Batch deburring in only 10 minutes! Part Dim.: 3/16" diameter x 1 3/16" long.





#### 0.01" Diameter Slot in Light Alloy Collar

Fine burrs in hard-to-reach slotted area. Eliminated part quality problem and saved labor costs. Part Dimensions: I 7/32" diameter x I/8" high.

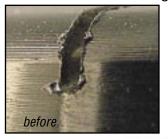



#### **EHD sPINner Machines**



LED Display	/	<u>Cycle Start</u>
Grand	Drogrammable Timer	
Speed Control	Programmable Timers (clockwise and counter clockwise deburring)	

Model No.	Dim. L x W x H	Tank Size L x W	Power	Amps	Weight
EHD-728	19" x 19" x 37"	11" x 11"	220V	5	160 lbs.
EHD-735	23" x 26" x 34"	15" x 16"	220V	10	220 lbs.
EHD-750	29" x 30" x 36"	21" x 23"	220V	15	385 lbs.

All power requirements are single phase.

Includes: 2 deburring containers, I separating container, and I manual. Media and deburring solution sold separately.

riedia and deburring solution sold separately


#### Stainless Steel Pin Media (SUS 304 with magnetic treatment)

This special stainless steel media is hardened to HRC 30, and will last for years in most applications. To deburr hard materials like stainless steel, steel, etc., use a diameter of media bigger than 0.5mm. Use sizes less than 0.5mm for soft material like brass, copper, aluminum, gold, etc. Choose larger pins for harder material and/or to increase deburring power.

If you want to deburr small holes, choose a diameter of pin media that is smaller than the hole. 3mm length media will work better for small holes and crevices.

1-10	Exi	-	1	in the second
12	1		Sec.	之行
63	and the second	a la		States
1 alla		1	250	

You can increase or decrease the power using the programmable control, or by selecting larger or smaller media. Parts are demagnetized at the end of the deburring cycle.

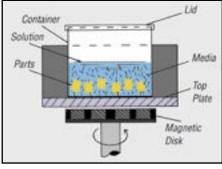

The only moving part is the magnetic disk!



Standard Dimension Media (diameter x length in millimeters)									
Part No.	EHD-S1	EHD-S2	EHD-S3	EHD-S4	EHD-S5	EHD-S6	EHD-S7	EHD-S8	EHD-S9
Size (mm)	0.2X5mm	0.3x5mm	0.4x5mm	0.5x5mm	0.7x5mm	0.8x5mm	1.0x5mm	1.2x5mm	1.5x5mm

Special Dimension Media (diameter x length in millimeters)								
Part No.	EHD-P1	EHD-P2	EHD-P3	EHD-P4	EHD-P5	EHD-P6	EHD-P7	EHD-P8
Size (mm)	0.3X3mm	0.4x3mm	0.5x1mm	0.5x3mm	0.7x3mm	0.8x3mm	1.0x1mm	1.0x3mm



#### **Deburring Solution**

Used with all types of materials. Dilute to a 50:1 ratio with water. Other solutions may be used, call for recommendations.

Model No.	Description			
PFS-747	1/2 gallon deburring solution			
PFS-7475G	5 gallons deburring solution			



- "One Twist" 360° adjustable joints
- Check concentricity on bench or your machine
- Powerful magnetic base

#### **Advantages of Hydraulic Arms**

- Hydraulic arms are faster, stronger, and more precise than mechanical joints
- Hydraulic joints make fine adjustments easy because they don't lose position when loosened like mechanical arms



Indicator Arms are used to check concentricity on bench or machine. Dial Indicators not included.



ECE-300 series





ECE-340

Part No.	Description	Arm Length	Base Dim. L x W x H	Holding Power	Weight Ib
ECE-300ALL	Precision hydraulic arm, gold	23 1/2"	4 3/4" x 2" x 2 1/8"	352 lbs.	7.75
ECE-300AL	Precision hydraulic arm, gold	16 3/4"	3 1/8" x 2" x 2 1/8"	220 lbs.	5.5
ECE-300B	Precision hydraulic arm, gold	13 3/8"	2 3/8" x 2" x 2 1/8"	176 lbs.	4.5
ECE-330AL	Precision mechanical arm, red	16 3/4"	3 1/8" x 2" x 2 1/8"	220 lbs.	5.0
ECE-330B	Precision mechanical arm, red	13 3/8"	2 3/8" x 2" x 2 1/8"	176 lbs.	3.75
ECE-340	Standard mechanical arm, red	13 3/8"	2 3/8" x 2" x 2 1/8"	176 lbs.	3.5

# EZ-Lift Magnets & MagVISE Workholding

### Load it & hold it faster and safer the "Earth Chain Way"

#### Quickly load and setup your workpiece

Use EZ-Lift, lifting magnets with MagVISE EEPM magnetic workholding chucks or ECB magnetic vises to significantly reduce material transport and workpiece set-up times.

#### **Powerful and reliable**

Both EZ-Lift magnetic lifters and MagVise magnetic vises turn on and off with a simple turn of a lever. Super-powerful neodymium iron boron magnets require no electricity and will never wear out.

#### Custom workholding fast

Use MagVISE magnetic vises to easily create custom workholding for large jobs and/or multiple workpieces.

#### You can machine all 5-sides

It's easy to perform complex 5-sided machining using the MagVise Vises or Electro-Permanent Chucks.

Call toll-free (800) 597-3921 Fax: (317) 803-8001 See all our products online at: www.techniksusa.com







© Copywrite 2009 Techniks, Inc. Indianapolis Indiana USA Non-copywritable materials are owned by their authors and are used for illustration purposes only.



Techniks / Earth Chain 9930 East 56th Street • Indianapolis, IN 46236 email: info@techniksusa.com Part No. LIT-ECCAT2009